


D thru D4 4 C PROM

Long Card goes  
Here (1-2)

Don't Remove  
This Wire

Insure Pin 2 is inserted thru board  
(U23)

Remove These  
Rows

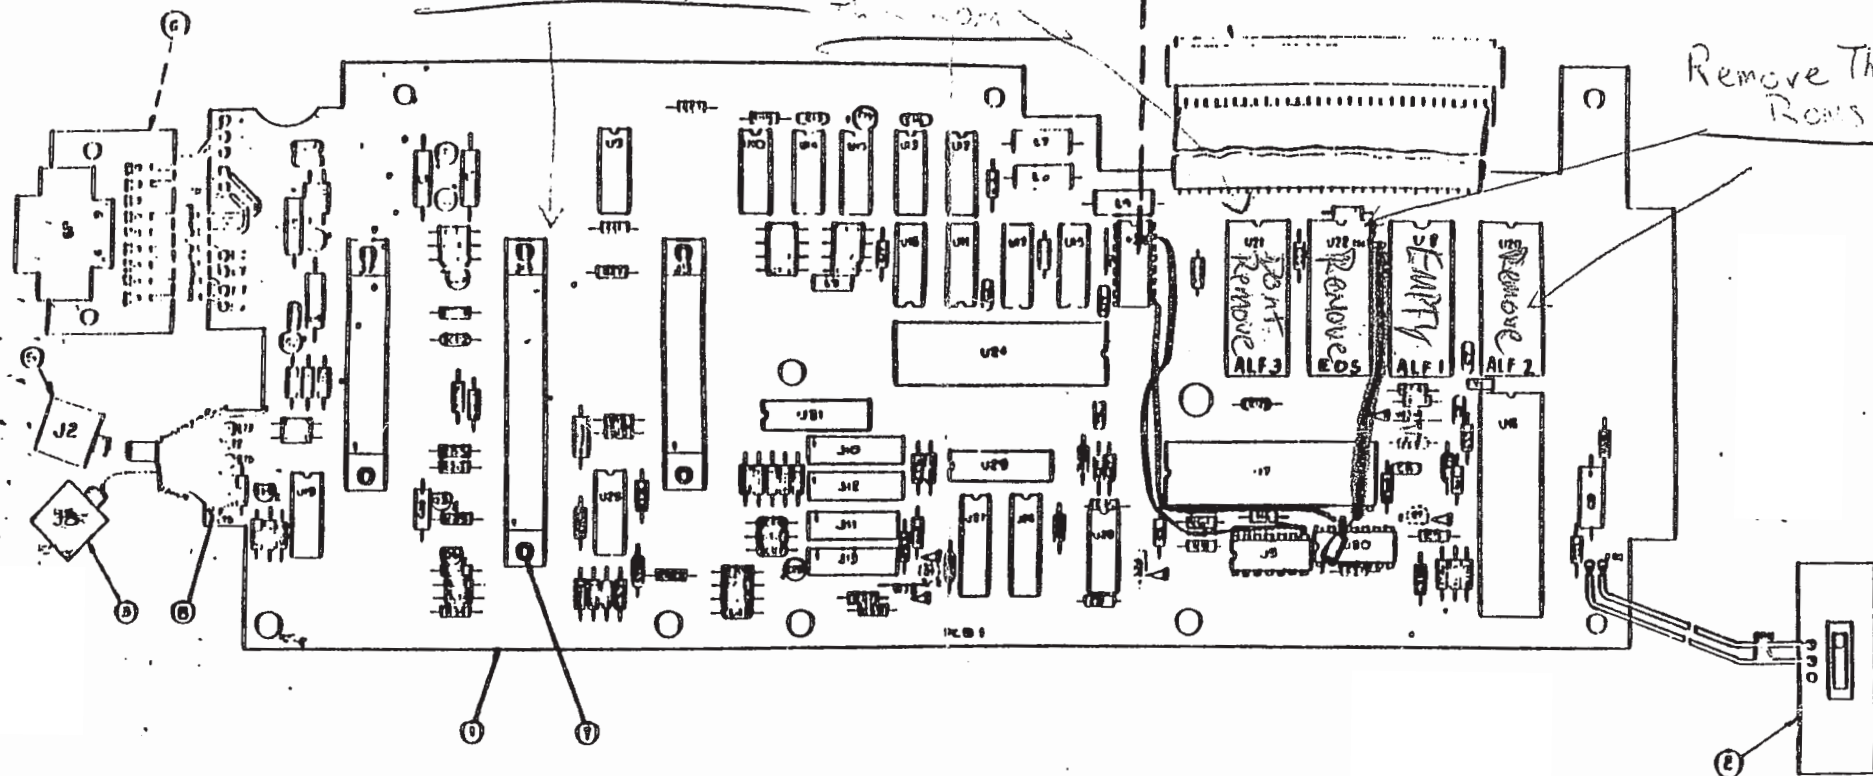


Add 4.7K Resistor From +5V below  
Pin 1 of U30 to Pin 19 of U7  
Double Socket U22, send  
lead 26 of Top Socket,  
Solder Jumper wire  
from Pin 26 to U7  
Pin 19. (Pin 19 of U7 lifted)

# LANG BOARD WIRING GUIDE

TO RUN LANG. BOARD: ① REMOVE 2 SPECIFIED ROMS. ② MAKE Jumper connections as stated on underside of logic board.

- 1) Jump Green to Green
- 2) Jump blue to blue
- 3) Jump Orange to Orange

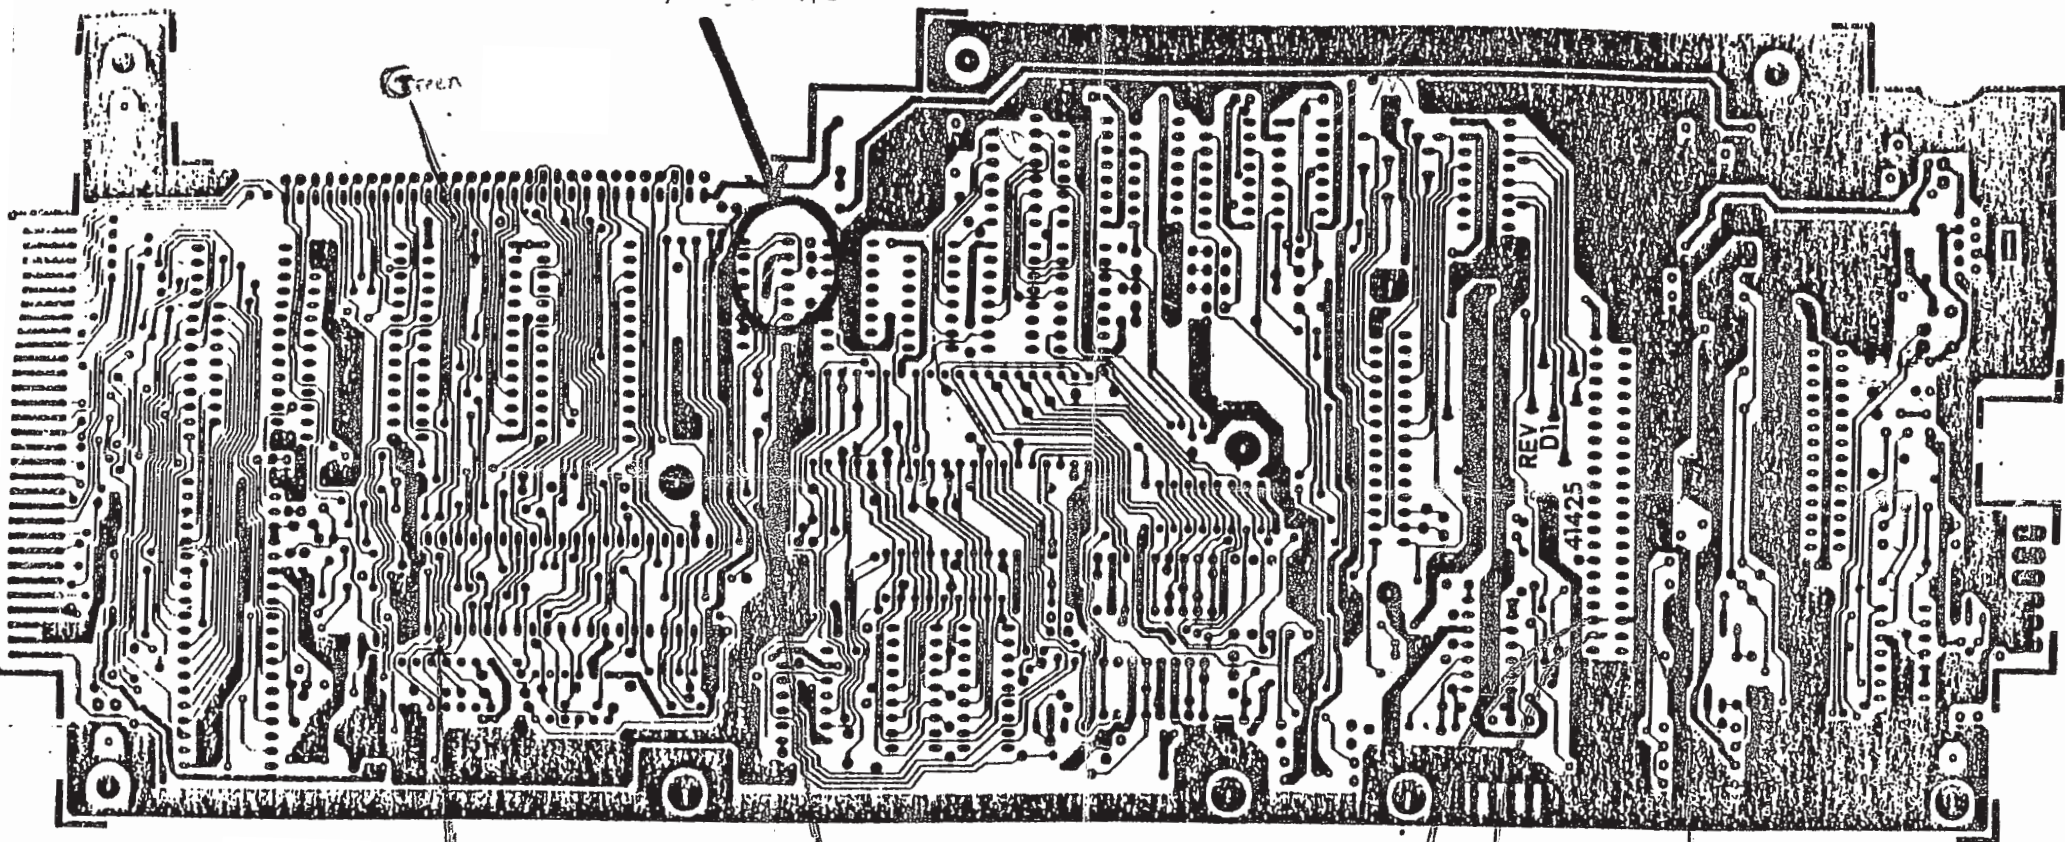

Blue SOLDER SIDE

Orange

23  
232

Green  
RV  
41425

Blue